

CONTINUED ON OTHER VIEWPORT

RIPARIAN HEADWALL REQUIRES RAKED TRASH SCREEN

RIPARIAN HYDROBRAKE CHAMBER REQUIRES MONITORING

RIPARIAN 'A N OTHER' MAINTENANCE & MANAGEMENT CO. BASIN POORLY MAINTAINED, HEADWALLS REQUIRE CONCRETE REPAIR MAINTENANCE AND RAKED TRASH SCREENS INSTALLED, HEADWALL APRONS REQUIRE DE-SILTING AND CLEARING OF FOLIAGE.

RIPARIAN SHORT LENGTH CULVERT, NO TRASH SCREENS - FORMER FIELD ENTRY POINT

RIPARIAN DITCH REQUIRES REGULAR MONITORING, THERE ARE A NUMBER OF BLOCKAGES WITH DEBRIS BUILDUP IN CHANNEL NEEDS TO BE CLEARED AND KEPT CLEAR TO MAINTAIN THROUGH FLOW

RIPARIAN DITCH AT THE BACK OF NUMBER 9 KINGS CLOSE NEEDS, REMOVAL OF FALLEN TREE, DIGGING OUT, DE-SILTING AND THE PIPE WORK JETTING THROUGH AS IT IS 75% FULL



RIPARIAN TWIN HEADWALL FLAP VALVE NOT FIT FOR PURPOSE CONSIDER REPLACEMENT

RIPARIAN OR UU? MH (18)

RIPARIAN OR UU? MH (13) REQUIRES REGULAR MONITORING TO ENSURE SW THROUGH FLOW

RIPARIAN MH (12A) REMEDIAL WORK TO BENCHING

RIPARIAN MH (12B) REMEDIAL WORK TO BENCHING

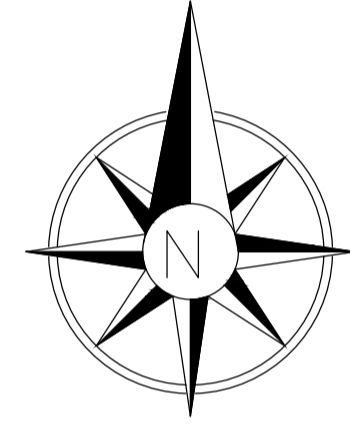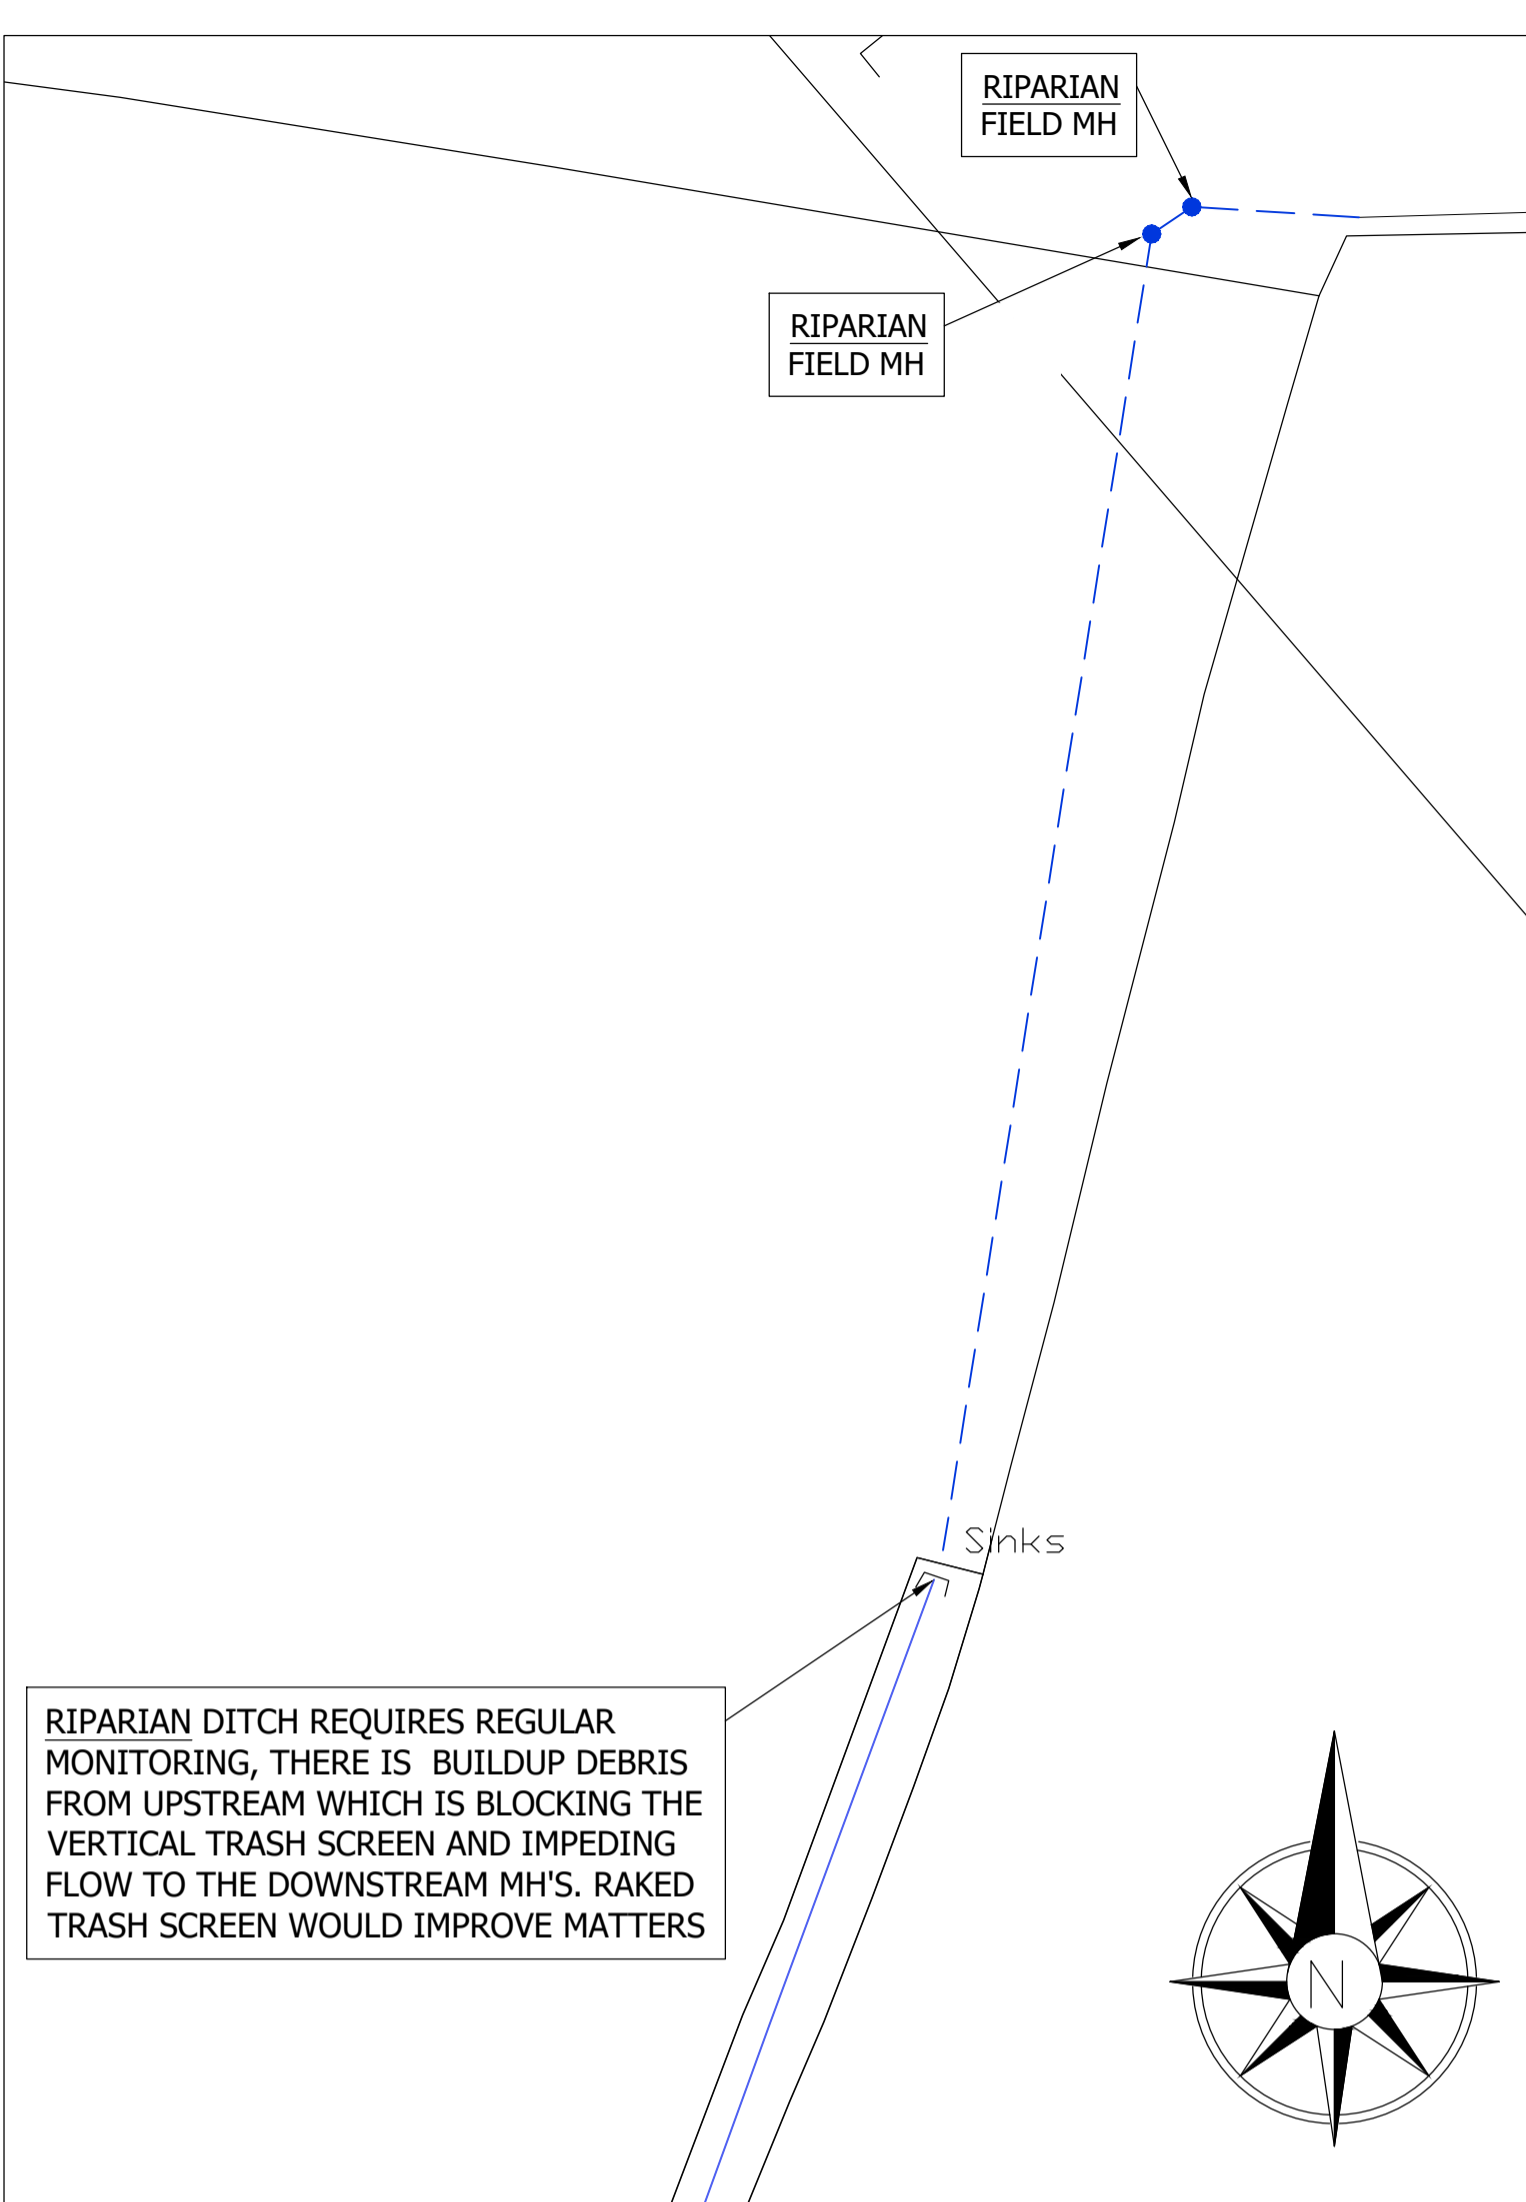

RIPARIAN DITCH REQUIRES REGULAR MONITORING, THERE IS BUILDUP DEBRIS FROM UPSTREAM WHICH IS BLOCKING THE VERTICAL TRASH SCREEN AND IMPEDING FLOW TO THE DOWNSTREAM MH'S. RAKED TRASH SCREEN WOULD IMPROVE MATTERS

Notes

1. MANHOLE CHAMBER POSITIONS ARE APPROXIMATE AND RELATIVE TO EXISTING PROPERTIES AND OTHER MAP REFERENCE POINTS.
2. MH CHAMBER REFERENCES ARE THE SAME AS THOSE USED IN THE LANCASHIRE CC COMMISSIONED DRAINAGE INVESTIGATION REPORT CARRIED OUT BY CJ JETZ LTD IN JULY 2019.
3. FOR REMEDIAL WORK TO CHAMBERS REFER TO THE PROPOSED WORKS SCHEDULE.

KEY

- EX. DRAINAGE DITCH & HEADWALL
- EXISTING PRIVATE SW SEWER
- EXISTING PUBLIC SW SEWER
- EXISTING PUBLIC FW SEWER & MH
- EX. PUBLIC COMBINED SEWER & MH
- EXISTING RIPARIAN DITCH REQUIRES MAINTENANCE / CONNECTING

Date Revision



Technical Services
Development Services
The Town Hall
Lytham St Annes
Lancashire
FY8 1LW

Tel: 01253 658658 E-mail: webmaster@fylde.gov.uk

Drawn By: AS Date: 12-2021

Checked By: AMS Scale: 1:500

STAINING_VILLAGE
SW_REMEDIAL_WORKS

GENERAL_ARRANGEMENT
EXISTING_ISSUES_SHEET_2_OF_2

Drawing Number:
TS18015-002